

Part 573 Safety Recall Report

22V-123

Manufacturer Name : Hyundai Motor America**Submission Date :** MAR 03, 2022**NHTSA Recall No. :** 22V-123**Manufacturer Recall No. :** 220**Manufacturer Information :**

Manufacturer Name : Hyundai Motor America

Address : 10550 Talbert Avenue

Fountain Valley CA 92708

Company phone : 800-633-5151

Population :

Number of potentially involved : 140

Estimated percentage with defect : 1 %

Vehicle Information :

Vehicle 1 : 2022-2022 Hyundai Elantra

Vehicle Type : LIGHT VEHICLES

Body Style : 4-DOOR

Power Train : GAS

Descriptive Information : The subject population includes 129 2022 model year Elantra vehicles produced for sale in the U.S. market on July 5, 2021, through November 22, 2021, by Hyundai Motor Company ("HMC").

Production Dates : JUL 05, 2021 - NOV 22, 2021

VIN Range 1 : Begin :

NR

End : NR

 Not sequential

Vehicle 2 : 2022-2022 Hyundai Elantra HEV

Vehicle Type : LIGHT VEHICLES

Body Style : 4-DOOR

Power Train : HYBRID ELECTRIC

Descriptive Information : The subject population includes 11 2022 model year Elantra HEV vehicles produced for sale in the U.S. market on July 5, 2021, through July 14, 2021, by Hyundai Motor Company ("HMC").

Production Dates : JUL 05, 2021 - JUL 14, 2021

VIN Range 1 : Begin :

NR

End : NR

 Not sequential

Description of Defect :

Description of the Defect : The front passenger seat belt pretensioners in the subject vehicles were installed from a suspect production lot containing pyrotechnic-type pretensioners that may deploy abnormally during a crash. At the time of this filing, the cause of the abnormal deployment is unknown. Hyundai is recalling vehicles equipped with pretensioners produced from the same production lot to conduct a detailed part return analysis. The part inspections and continuing active investigation will determine if a specific root cause and defect trend exists.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : An abnormal pyrotechnic pretensioner deployment in the event of a crash could cause metal fragments to enter the vehicle occupant compartment, that may cause injury to vehicle occupants.

Description of the Cause : Hyundai is actively investigating root cause.

Identification of Any Warning
that can Occur : NR

Involved Components :

Component Name 1 : S/BELT ASSY-FR P/TENSR 3PT RH

Component Description : Seat belt assembly w/ pretensioner for passenger' side

Component Part Number : 88820-AA500

Supplier Identification :**Component Manufacturer**

Name : Samsung

Address : 62-30 Jungdong St

Seongsan-gu Changwon-City, Gyeongnam Foreign States 51553

Country : Korea, Republic of

Chronology :

Please see Attachment A for the requested chronology of events.

Description of Remedy :

Description of Remedy Program : Hyundai Motor America plans to notify owners of affected vehicles by first class mail with instructions to bring their vehicles to a Hyundai dealer to have the seat belt pretensioner(s) replacement remedy performed. This remedy will be offered at no cost to owners for all affected vehicles, regardless of whether the affected vehicles are still covered under Hyundai's New Vehicle Limited Warranty. Additionally, Hyundai will provide owners of affected vehicles reimbursement for out-of-pocket expenses incurred to obtain a remedy for the recall condition in accordance with the reimbursement plan submitted to NHTSA on February 24, 2022.

All returned pretensioners will be collected for further analysis into root cause.

How Remedy Component Differs from Recalled Component : N/A

Identify How/When Recall Condition was Corrected in Production : N/A

Recall Schedule :

Description of Recall Schedule : Dealers and owners will be notified in accordance with the schedule provided with this report.

Planned Dealer Notification Date : MAY 02, 2022 - MAY 02, 2022

Planned Owner Notification Date : MAY 02, 2022 - MAY 02, 2022

* NR - Not Reported